

Page 1 of 8 Rev A2


PLUG ASSEMBLY INSTRUCTIONS FOR Cable with INDIVIDUALLY SHIELDED PAIRS (PIMF or SFTP) T568B Wiring Pattern


For Cable with Overall Foil Shield (FTP), See Page 5

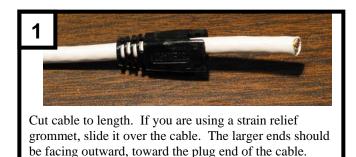

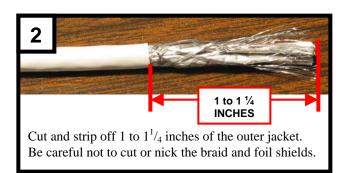



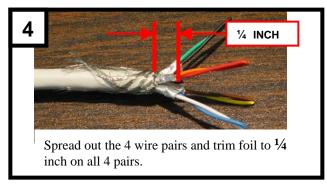

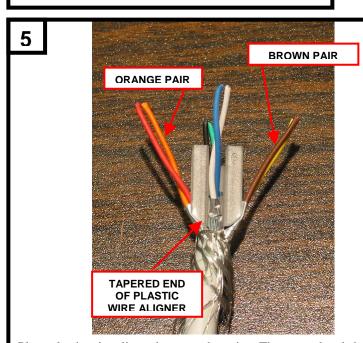




OTHER END OF CABLE SHOWING GREEN PAIR IN FRONT


Place plastic wire aligner between the pairs. The tapered end should be toward the braid and jacket. The orange pair will go to the deep channel on the left side and the brown pair will go toward the deep channel on the right. The blue and green pairs will go to the sides that have shallow channels at the middle.

Instruction Sheet MN390011

Page 2 of 8 Rev A2


6

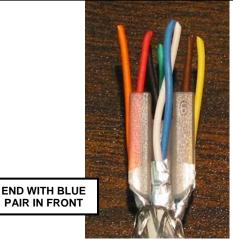

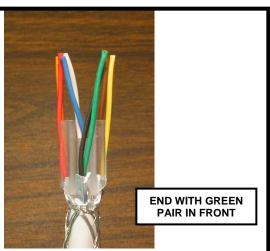


Push the wire aligner down as far as it will go and push pairs into wire aligner channels. Flatten out the wires and arrange the insulation colors so that they match the T568B color map. Keep the red on left and the brown on right. On one end of the cable the blue pair will be towards you, and the green pair will be towards you on the other end.

 7




RED ORANGE BLACK BLUE WHITE GREEN YELLOW BROWN

 The color pattern shown in these pictures represent the wiring colors used by one manufacturer. Wiring colors may vary by cable. Please verify the color pattern specific to your particular requirements. Shown below is a more typical color scheme.



When aligning the wires to the color pattern, maintain the existing twist of the wire pairs. Do not add or remove more than $\frac{1}{2}$ twist to any pair to achieve the required color pattern.


8

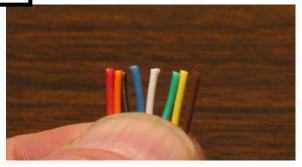

Trim the ends of the wires to make them even. This will make it easier to insert the wires into the load bar. Remove the least amount of wire necessary to even out the wires.

9

SLOTS

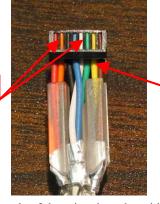

WEDGE

Insert the ends of the wires into the wide end of the load bar, maintaining the wire color sequence. The side with the slots and the wedge shaped end should be facing towards you

Instruction Sheet MN390011

Page 3 of 8 Rev A2

10



Bring the loadbar down, tight against the plastic wire aligner. Trim the wires flush to the loadbar.

Dress the braid to one side of the jacket.

12



Wrap the braid over the jacket. Press the foil covered pairs fully into the slots in the channels of the plastic wire aligner. Ensure that the foil does not stick out as this makes it difficult to insert this assembly into the plug body.


13




Keep the orange pair to the left and the brown to the right. Push the assembled wires, loadbar, and plastic wire aligner into the plug body subassembly. The plug latch tab should be facing away from you. Firmly push the plug until the wires come in contact with the front inside surface of the plug.

Instruction Sheet MN390011

Page 4 of 8 Rev A2

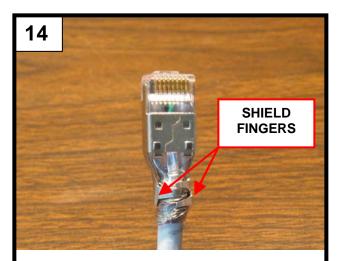

Bend the plug shield fingers inward toward the cable. Press the shield fingers as far as they will go. They should easily fit into the Shield Crimp portion of the crimping tool.

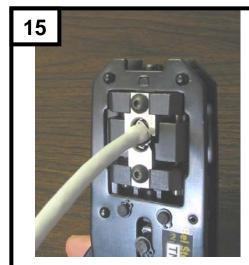


Insert the un-terminated plug into the crimp tool. Make sure that the plug is fully seated in the tool.

16



Squeeze the handles of the crimp tool together until they are fully depressed, and will open when the handle is released.

Remove the terminated plug from the crimp tool.

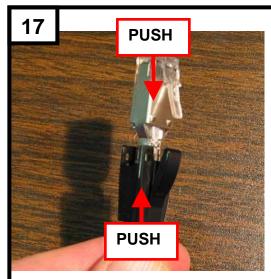

If used, align the strain relief grommet and push it over the terminated plug body. Snap it in place.

Repeat the above procedure for the other end of the patch cord.

Test the completed cable assembly to ensure that it meets your performance requirements.

Page 5 of 8 Rev A2


FOR Cable with an OVERALL FOIL SHIELD

(FTP – Foil Screened Twisted Pair)

T568B Wiring Pattern



Cut cable to length. If you are using a strain relief grommet, slide it over the cable. The larger ends should be facing outward, toward the plug end of the cable.

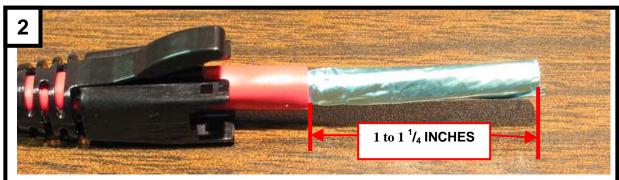


Cut and strip off 1 to $1^{1}/_{4}$ inches of the outer jacket. Be careful not to cut or nick the drain wire and foil shield.




Fold the foil shield and drain wire back over the cable jacket.


Instruction Sheet MN390011

Page 6 of 8 Rev A2

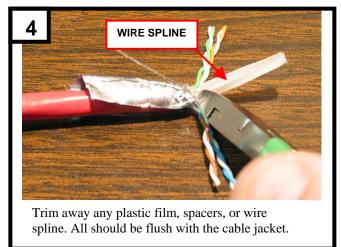


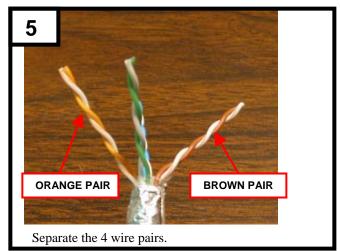


END WITH BLUE PAIR IN FRONT

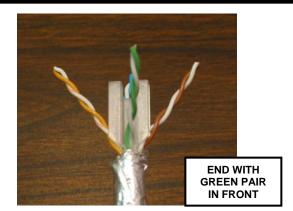

Place plastic wire aligner between the pairs. The tapered end should be toward the braid and jacket. The orange pair will go to the deep channel on the left side and the brown pair will go toward the deep channel on the right. The blue and green pairs will go to the sides that have shallow channels at the middle. On one end of the cable the blue pair will be towards you, and the green pair will be towards you on the other end.

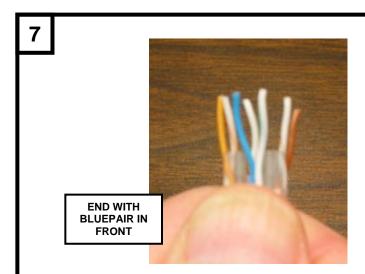

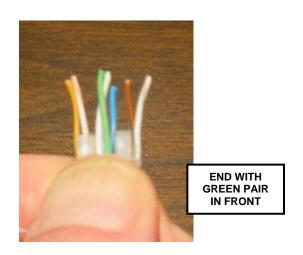


Make sure that the wire aligner is tight to the cable jacket. Untwist the wire back to the top of the wire aligner. Straighten the exposed wires as flat as possible.

Instruction Sheet MN390011


Page 7 of 8 Rev A2

8

 
Arrange the wire colors so that they match the T568B color map. Keep the orange pair on left and the brown pair on right. Do not add or remove more than $\frac{1}{2}$ of a twist to any pair to achieve this color pattern.




Color pattern above represents an example of the wiring colors used by one manufacturer. Wiring colors may vary by cable. Please verify the color pattern specific to your particular requirements.

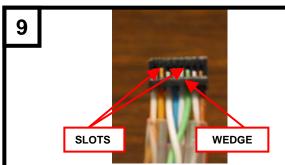


Trim the ends of the wires to make them even. This will make it easier to insert the wires into the load bar. Remove the least amount of wire necessary. Insert the ends of the wires into the wide end of the load bar, maintaining the wire color sequence. The side with the slots and the wedge shaped end should be facing towards you.

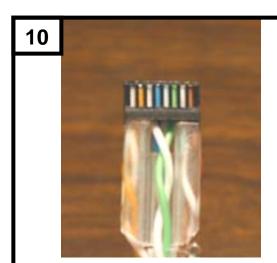

Bring the loadbar down, tight against the plastic wire aligner. Trim the wires flush to the loadbar.

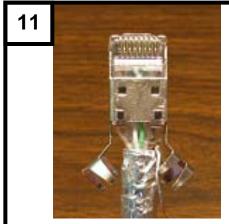


Wrap the drain wire around the foil near the wire aligner. Keep the orange pair to the left. Push the assembled wires, loadbar, and plastic wire aligner into the plug body subassembly. The plug latch tab should be facing away from you. Firmly push the plug until the wires come in contact with the front inside surface of the plug.

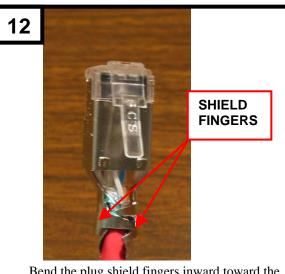


Bend the plug shield fingers inward toward the cable. Press the shield fingers as far as they will go. They should easily fit into the Shield Crimp portion of the crimping tool.


Page 8 of 8 Rev A2

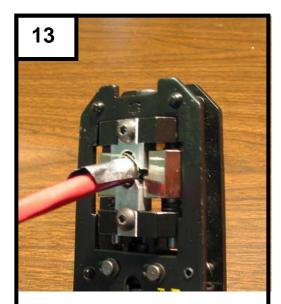

Insert the un-terminated plug into the crimp tool. Make sure that the plug is fully seated in the tool. Squeeze the handles of the crimp tool together until they are fully depressed, and will open when the handle is released.

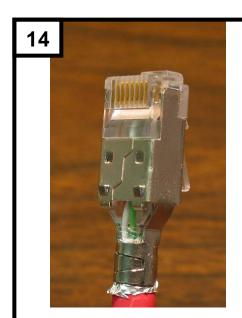

Remove the terminated plug from the crimp tool and trim off any excess foil and drain wire.

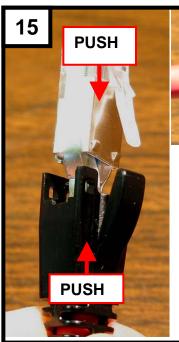



If used, align the strain relief grommet and push it over the terminated plug body. Snap it in place.

Repeat the above procedure for the other end of the patch cord.

Test the completed cable assembly to ensure that it meets your performance requirements.